
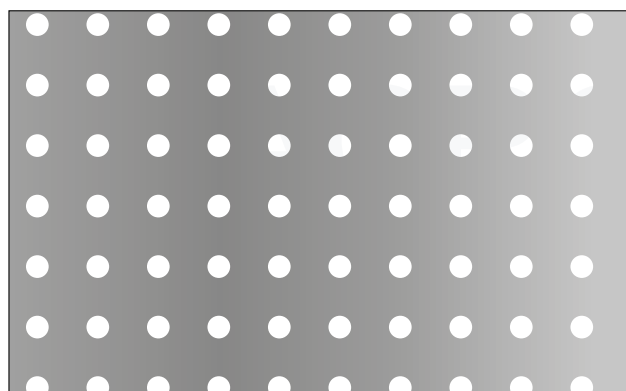
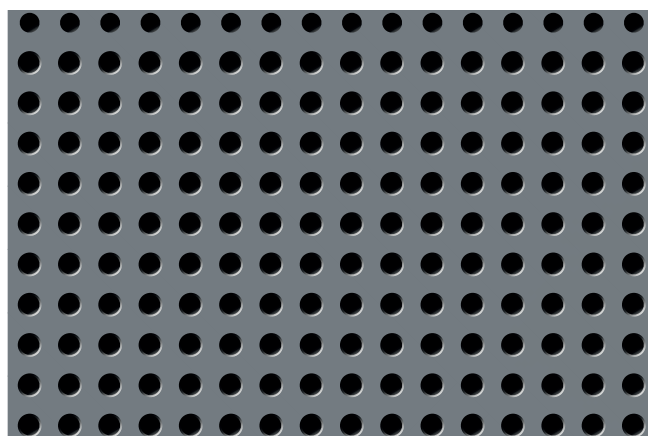



Perforált lemez, kerek szemekkel, átlós elrendezéssel, 90° rozsdamentes

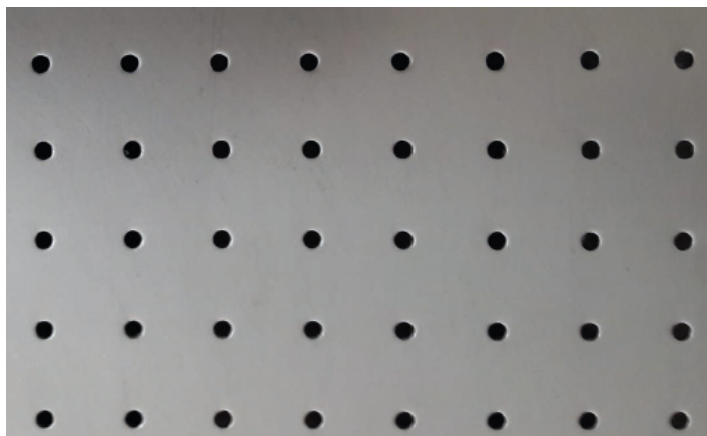

R 3

U 8


VP 11,0%

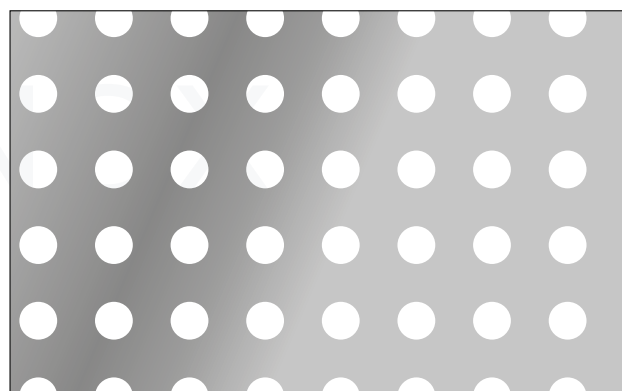

R 5

U 10

VP 19,5%

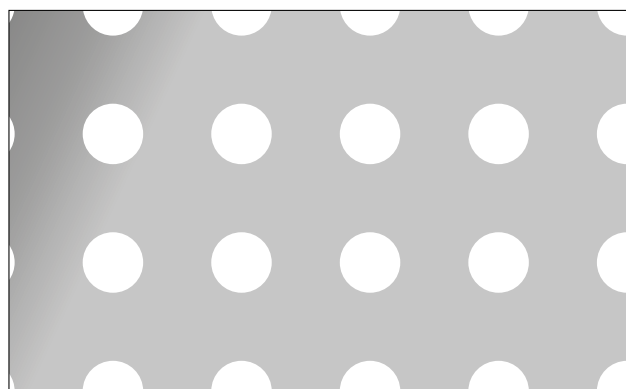

R 8

U 17

VP 17,4%



R 10

U 20

VP 19,5%

Perforált lemez, kerek szemekkel, átlós elrendezéssel, 90° rozsdamentes


Műszaki információk

d = Lyukátmérő

U = Lyuk tengelytáv

% = Szabd terület = $78,5 \times d^2 / U^2$

dm^2 = Lyukszám = $10.000 / U^2$

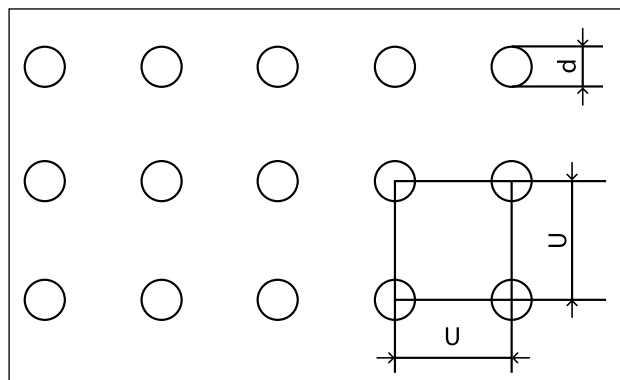

Lyuk tip.	U (mm)	U (mm)	dm^2	%
R 1	3	3	1111	8,6
	4	4	625	4,8
	5	5	400	3,1
	10	10	100	7,8
R 1,5	3	3	1111	19
	5	5	400	7
R 2	4	4	625	19,5
	5	5	400	12,5
	10	10	1000	3,1
	15	15	445	1,4
R 2,5	5	5	400	19,5
	10	10	100	4,8
	15	15	44,5	2,1
R 3	6	6	167	19,5
	8	8	156	11
	10	10	100	7
	12	12	70	4,8
	15	15	44,5	3,1
	20	20	25	1,8
R 4	8	8	156	19,5
	10	10	100	12,5
	12	12	70	8,6
	15	15	44,5	5,5
	20	20	25	3,1
	25	25	16	2
R 5	8	8	156	30,4
	10	10	100	19,5
	15	15	44,5	8,7
	18	18	31	6

Perforált lemez, kerek szemekkel, átlós elrendezéssel, 90° rozsdamentes

Lyuk tip.	U (mm)	U (mm)	dm ²	%
R 5	20	20	25	4,8
	25	25	16	3,1
R 6	10	10	100	28
	12	12	70	19,5
	15	15	44,5	12,5
	20	20	25	7
R 8	15	15	44,5	22,2
	18	18	31	15,4
	20	20	25	12,5
	25	25	16	8
	30	30	11	5,5
R 10	15	15	44,5	34,6
	20	20	25	19,5
	25	25	16	12,5
	30	30	11	8,6
R 12	20	20	25	28
	24	24	17,3	19,5
	28	28	12,7	14,3
R 15	25	25	16	28
	30	30	11	19,5
	35	35	8	14,3
	40	40	6,2	11
R 18	28	28	12,7	32,3
	36	36	7,7	19,5
	40	40	6,2	15,8
R 20	30	30	1	34,7
	35	35	8	25,5
	40	40	6,2	19,5
	50	50	4	12,5
R 25	35	35	8	39,7
	40	40	6,2	30,4
	50	50	4	19,5
R 30	45	45	5	34,7
	50	50	4	28
	60	60	2,7	19,5